





ASSEMBLY INSTRUCTION

BNC | 75Ω Cable Jack Panel version


A

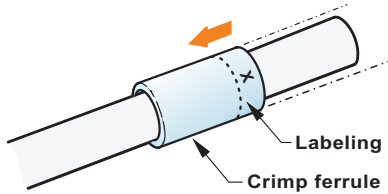



B

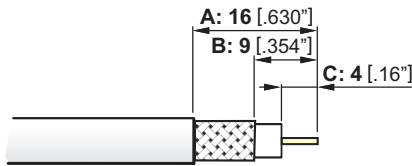

C

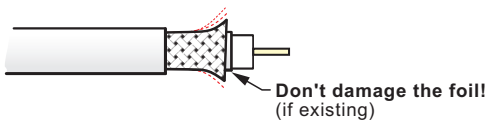


D

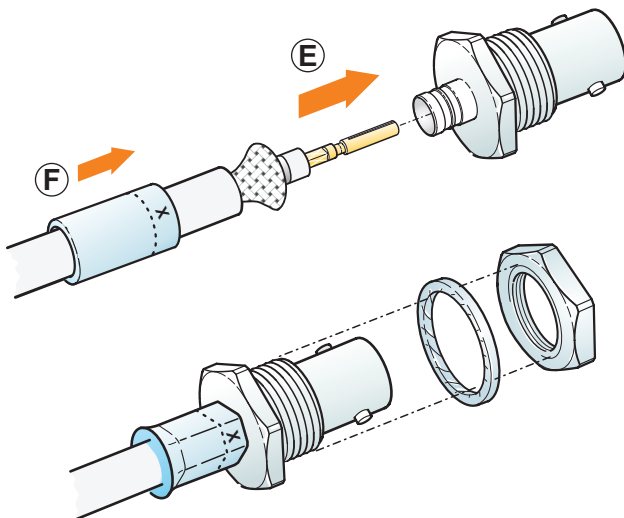 

A Slide the crimp ferrule onto the cable

B Prepare cable as shown
- Use an adjustable coaxial cable stripper

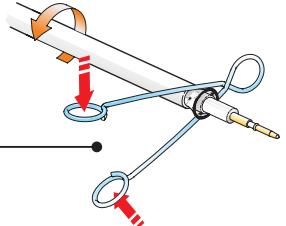
C Spread the braided shield
(It's easily with the Neutrik "SHIELD-SPREADING-TOOL"!) 

D Crimp the pin
- position the pin on the center conductor
- Crimp the pin with the tool
(For best crimping-results it is recommended to use the original Neutrik crimp tool
- HXBNC with the corresponding insert
or hexcrimp acc. to IEC 803-W (SW 1.7)
or squarecrimp acc. to IEC 803-2 (SW 1.6)
- Pin can also be soldered (Optional)!
- Straighten the pin if misaligned.

E Insert the cable into the connector body

F Slide the crimp ferrule over the shield to the front and push the cable and leading ferrule to it's end position until you hear a snap noise.

G Crimp the ferrule with the tool
(For best crimping-results it is recommended to use the original Neutrik tool - HXBNC with the corresponding insert)

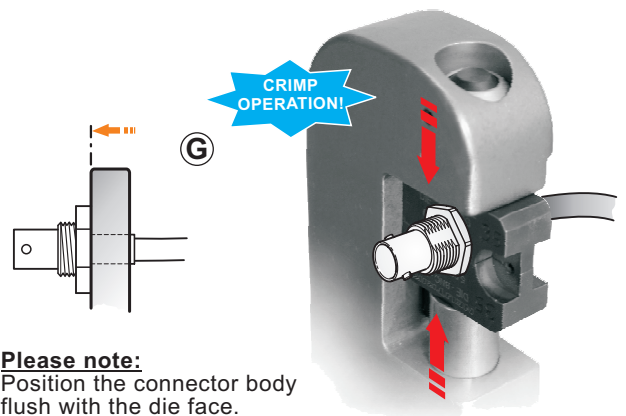

Please note:
Position the connector body flush with the die face.

NEUTRIK AG LI T: +423 / 237 24 24 F: +423 / 232 53 93
NEUTRIK Zürich AG CH T: +41 44 / 736 5010 F: +41 44 / 736 5011
NEUTRIK USA Inc. USA T: +1 732 / 901 9488 F: +1 732 / 901 9608
NEUTRIK (UK) Ltd. UK T: +44 1983 / 811 441 F: +44 1983 / 811 439

NEUTRIK Vertriebs GmbH DE/NL/AT T: +49 8131 / 280 890 F: +49 8131 / 280 830
NEUTRIK France FR T: +33 1 / 4131 6750 F: +33 1 / 4131 0511
NEUTRIK Tokyo Ltd. JP T: +81 3 / 3663 4733 F: +81 3 / 3663 4796
NEUTRIK Hong Kong Ltd. HK T: +852 / 2687 6055 F: +852 / 2687 6052

Draft. Nr.: BDA 120 / 3102M1201 | Update: 09.04.2008 | Data subject to change without prior notice. ©2008NEUTRIK®. ALL RIGHTS RESERVED.

www.neutrik.com

NEUTRIK